

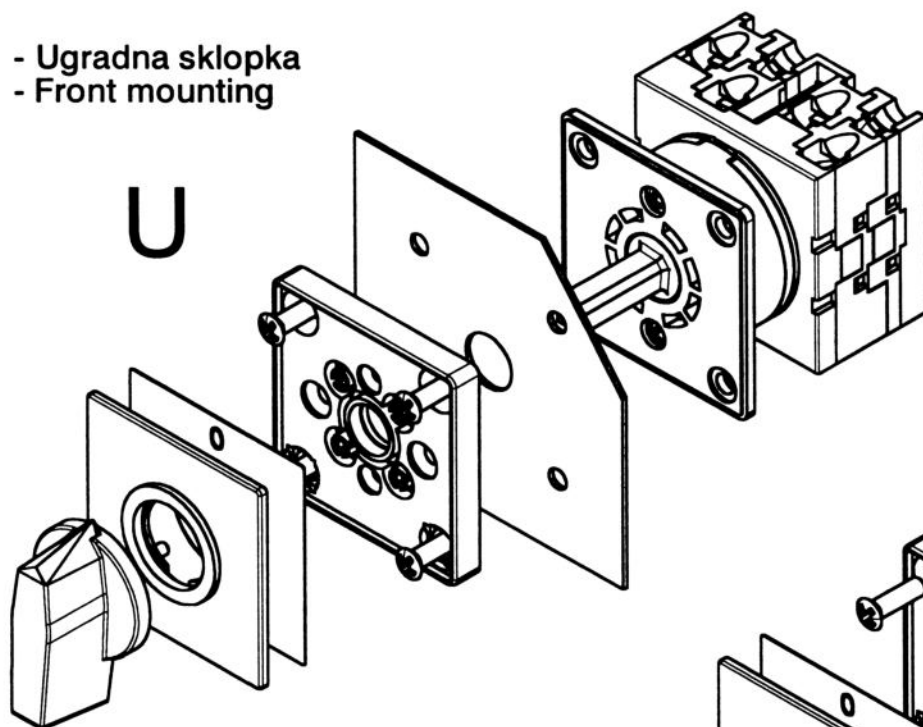



- Ugradna sklopka
- Front mounting

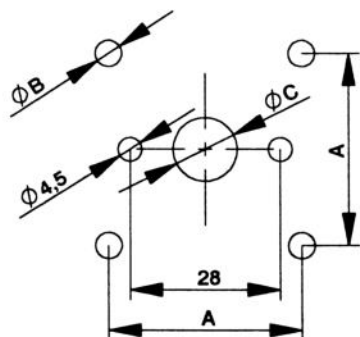

- Odvojena ugradnja
- Rear mounting

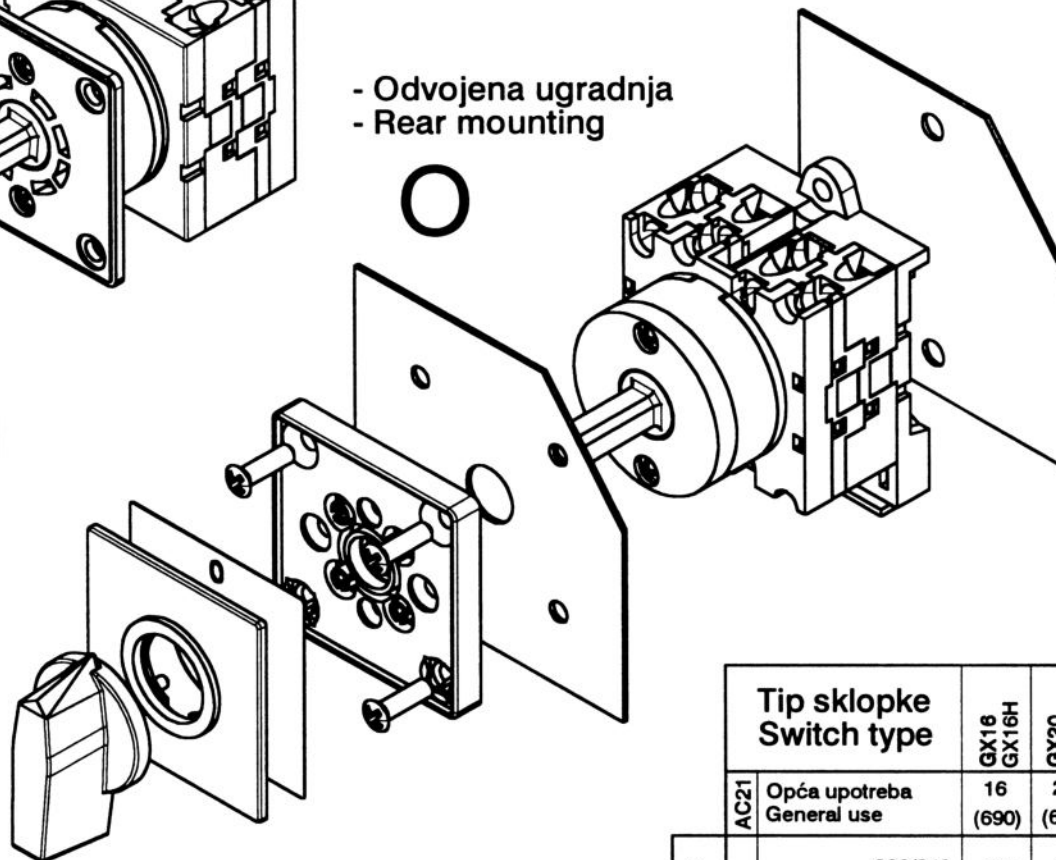

Sklopke Switches		□ A Ø B Ø C D			
		A	B	C	D
GX16 GX20		36	5	12	52
		48	5,5	12	52
GX32 GX40		48	5,5	14	68
		68	7,5	14	68

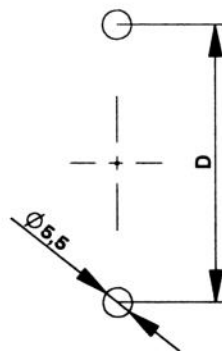

Tip sklopke Switch type

		GX16 GX16H	GX20 GX20H	GX32 GX32H	GX40 GX40H
AC21	Opća upotreba General use	16 (690)	20 (690)	32 (690)	40 (690)

Motorska sklopka za kategoriju upotrebe Motor switch in utilization category		AC21 (kW)	AC3 (kW)	AC23 (kW)		GX16 GX16H	GX20 GX20H	GX32 GX32H	GX40 GX40H
3 Faze 3 Phasen	220/240	3,5	3,7	7,5	7,5				
	380/440	4,5	5,5	11	15				
	500/690	5,5	5,5	11	15				
1 Faza 2 Pola 1 Phase 2 Pole	110	0,75	0,75	1,8	2,2				
	220/230	1,5	1,8	3,5	4,4				
	380/440	2,2	3	5,5	7				
3 Faze 3 Phase	220/240	3,7	4	8	9				
	380/440	6,5	7,5	15	18,5				
	500/690	7,5	7,5	15	15				
1 Faza 2 Pola 1 Phase 2 Pole	110	0,75	0,75	2,2	3				
	220/230	1,8	2,2	3,5	5,2				
	380/440	3	3,5	6	7,5				

Suitable for Use on Circuits Capable of Delivering not more than 5000 rms Symmetrical Amperes, 600 V ac Maximum, when protected by RK 5 Class Fuses rated ** A max.




**	Cat. No.
40 A	For GX16 and GX20
125 A	For GX32 and GX40

"Use fuses Only"


Minimum enclosure size: 125 mm x 185 mm x 118 mm (W x H x D)




**SKLOPKE SA KUTEM ZAKRETA 60°
SWITCHES WITH 60° SWITCHING**

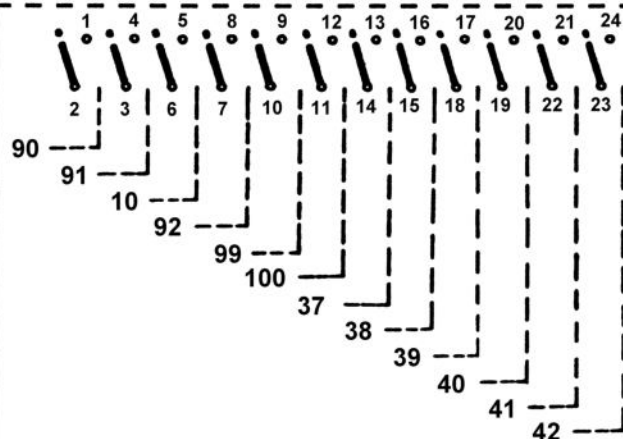


**PREKLOPKE SA "0" POLOŽAJEM SA
KUTEM ZAKRETA 60°
CHANGEOVER SWITCHES WITH "0" 60° SWITCHING**

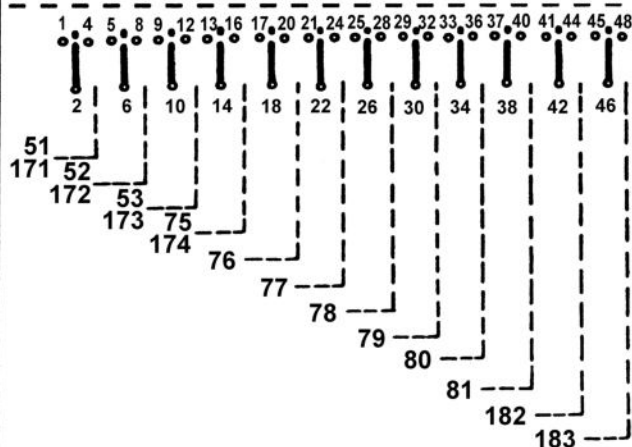


**PREKLOPKE BEZ "0" POLOŽAJA SA
KUTEM ZAKRETA 90°
CHANGEOVER SWITCHES WITHOUT "0" 90° SWITCHING**

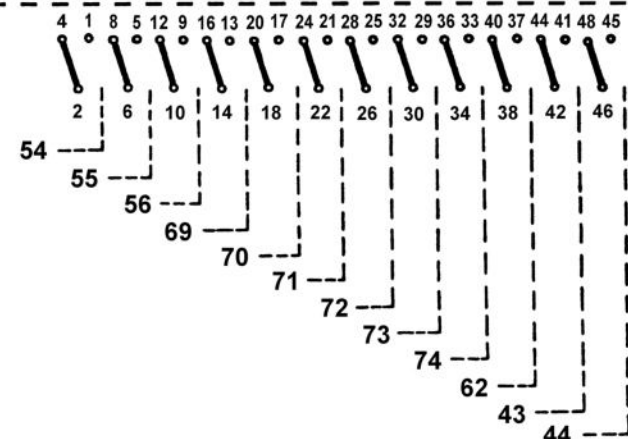



SKLOPKE SA KUTOM ZAKRETA 90° / SWITCHES WITH 90° SWITCHING

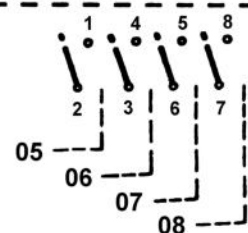




09

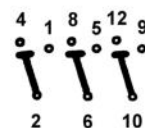


57

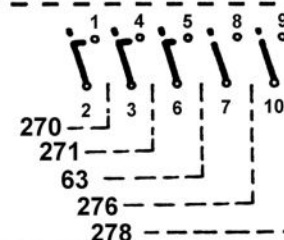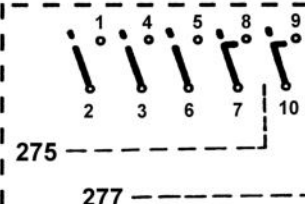


STEPENASTE SKLOPKE BEZ "0" POLOŽAJA / MULTI-STEP SWITCHES WITHOUT "0"

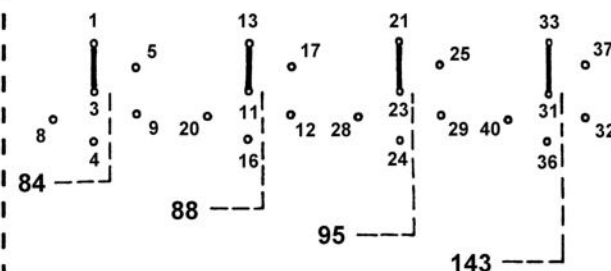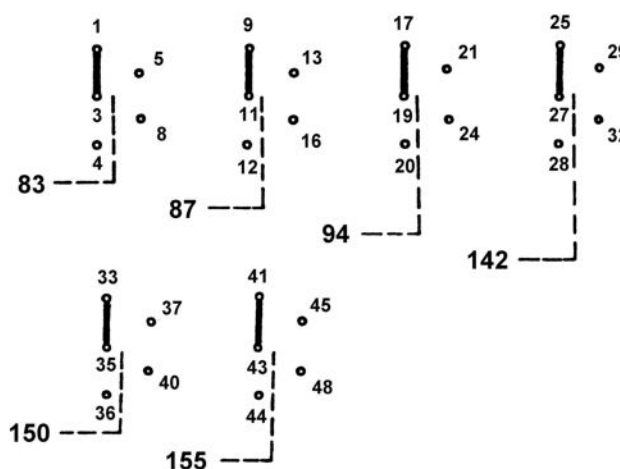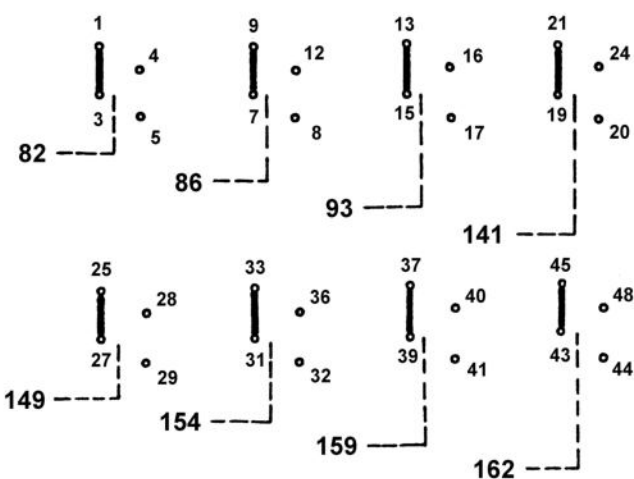


AMPERMETARSKE SKLOPKE / AMMETER SWITCHES

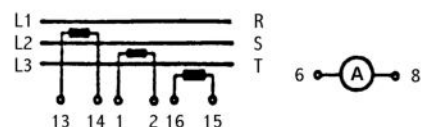

58

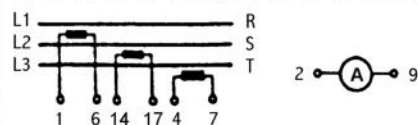


97

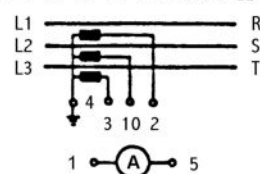


98

VOLTMETARSKO - AMPERMETARSKE SKLOPKE VOLTMETER - AMMETER SWITCHES

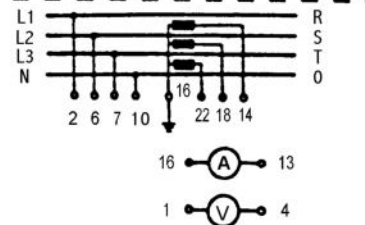


61

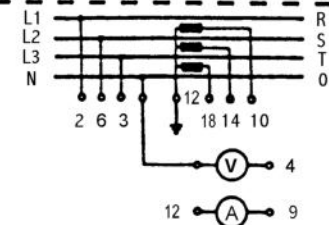


64


VOLTMETARSKE SKLOPKE / VOLTMETER SWITCHES

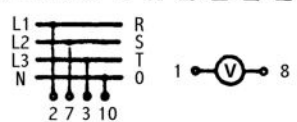


60

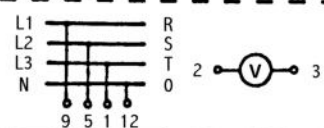


66

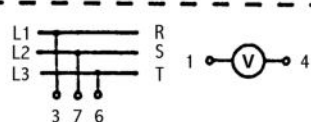

67



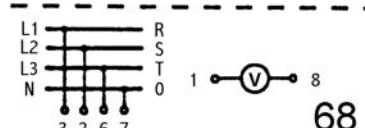


68

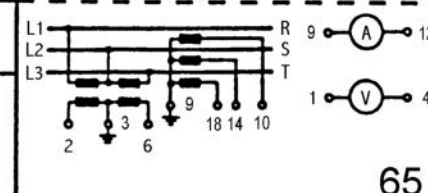


65


SKLOPKE SA POVRATOM - KUT ZAKRETA 30° SWITCHES SPRING RETURN WITH 30° SWITCHING

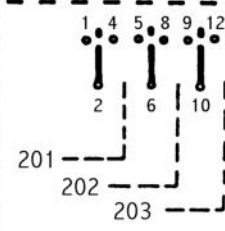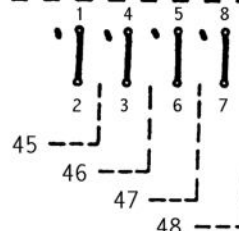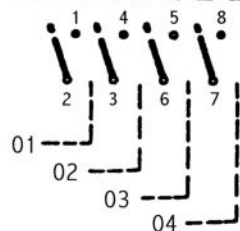


SKLOPKE ZA POKRETANJE JEDNOFAZNIH MOTORA START AND RUN SWITCHES

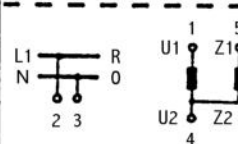

15


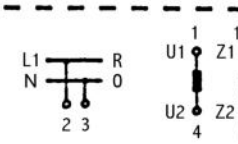


16

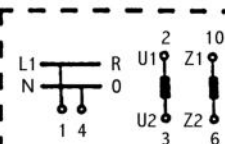


50, 17


UPRAVLJAČKE SKLOPKE SA POVRATOM / CONTROL SWITCHES (WITH SPRING RETURN)

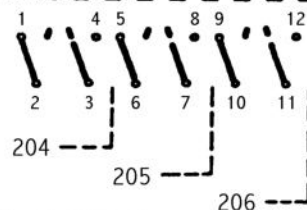

207

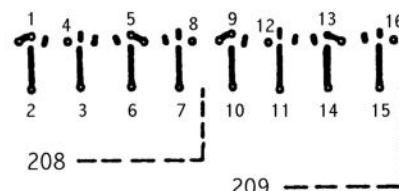


208

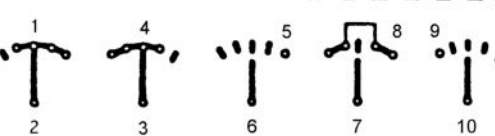


210


MOTORSKE REVERZIONE SKLOPKE / MOTOR REVERSING SWITCHES

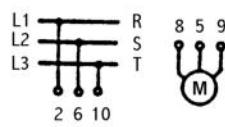


166, 11

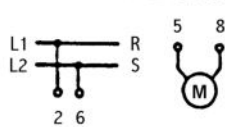


14

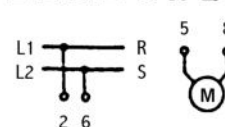


24

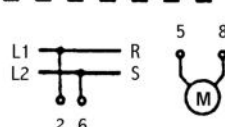

25

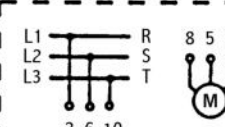


26

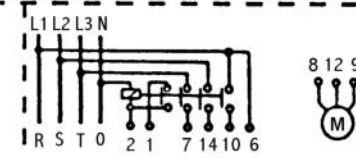


27


ZVIJEZDA - TROKUT SKLOPKE / STAR - DELTA SWITCHES

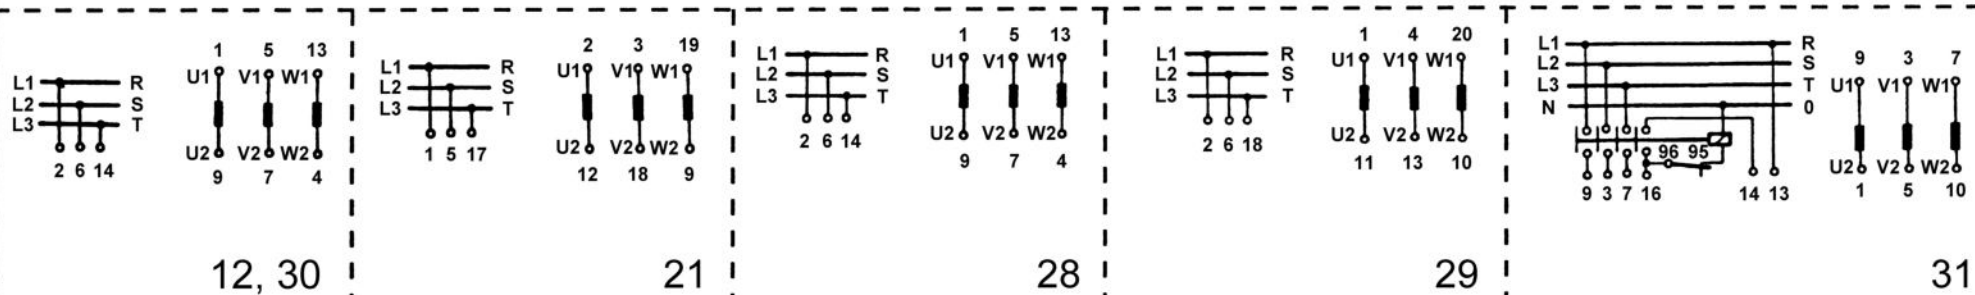


SKLOPKE ZA UPRAVLJANJE MOTORIMA (ODVOJENI NAMOTI) MOTOR CONTROL SWITCHES (SEPARATE WINDINGS)

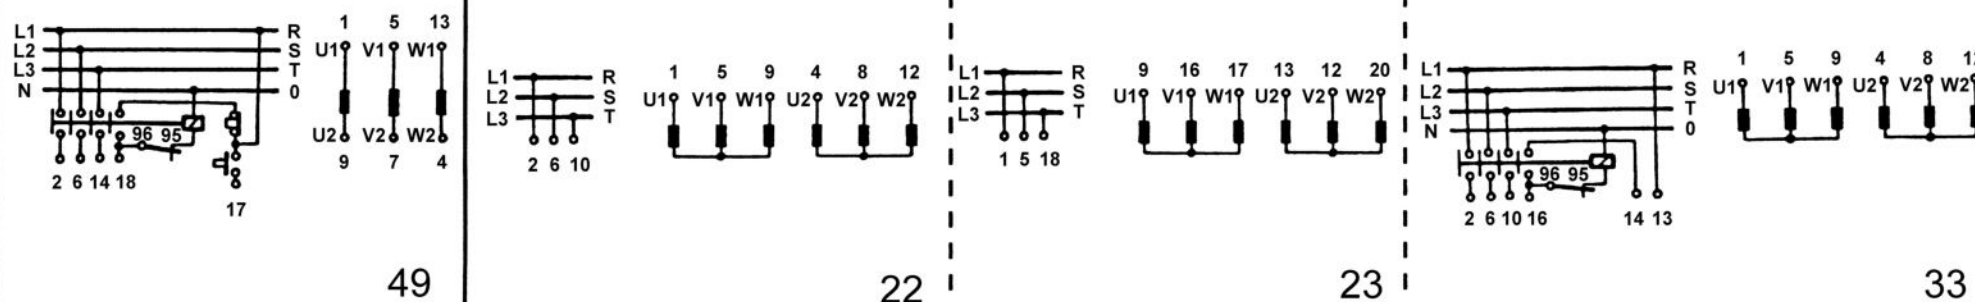


SKLOPKE ZA UPRAVLJANJE MOTORIMA (DAHLANDER) / MOTOR CONTROL SWITCHES (DAHLANDER)

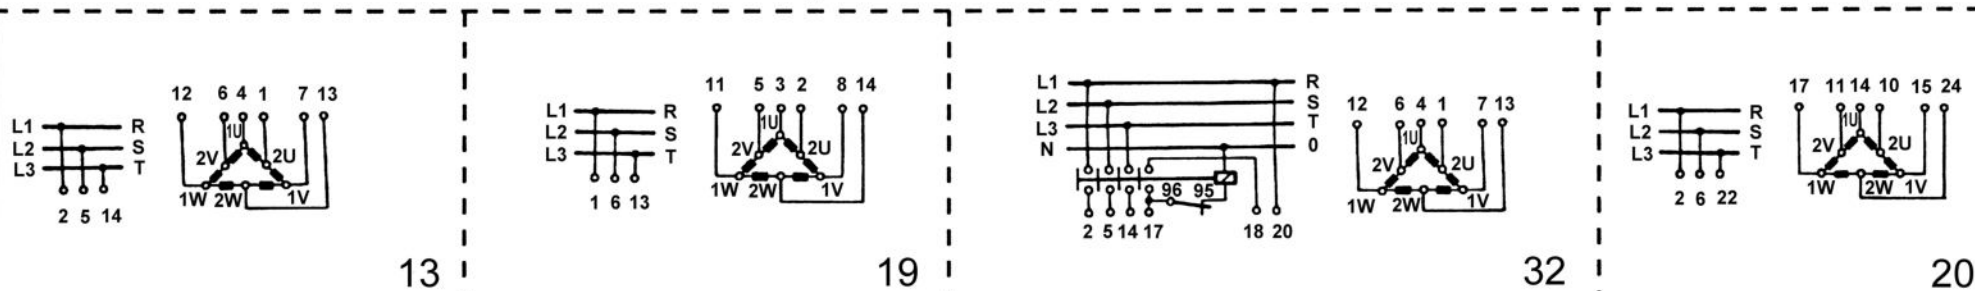


SKLOPKE ZA UPRAVLJANJE TROBRZINSKIM MOTORIMA / SWITCHES FOR 3-SPEED MOTOR CONTROL

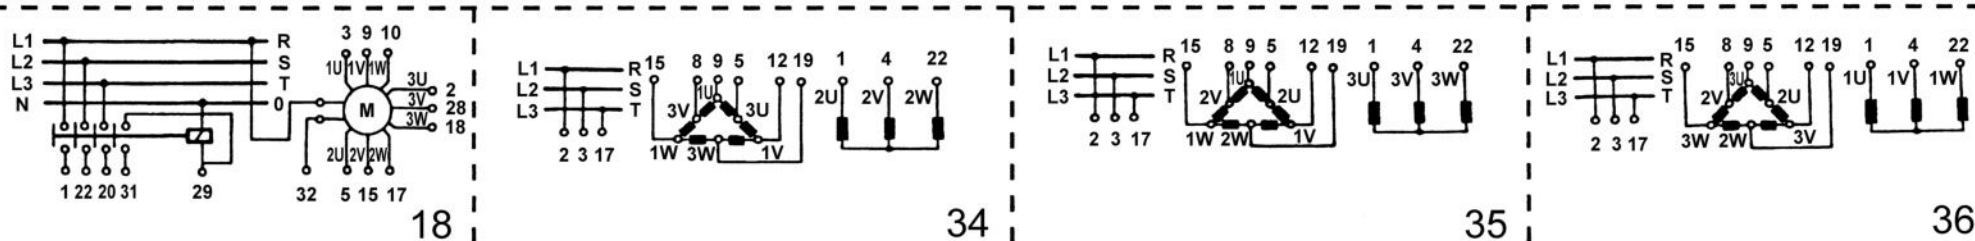






STEPENASTE SKLOPKE BEZ "0" POLOŽAJA / MULTI-STEP SWITCHES WITHOUT "0"

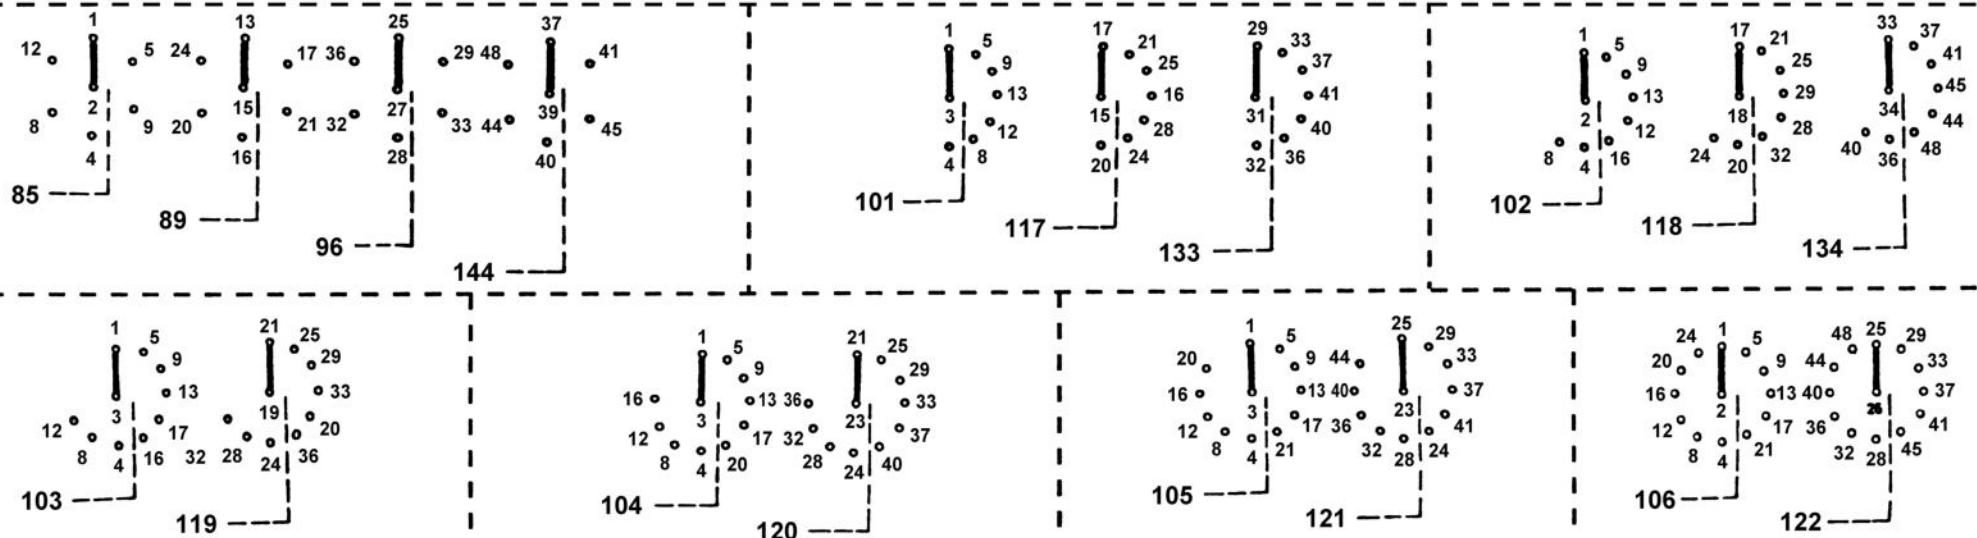











STEPENASTE SKLOPKE SA "0" POLOŽAJEM / MULTI-STEP SWITCHES WITH "0"

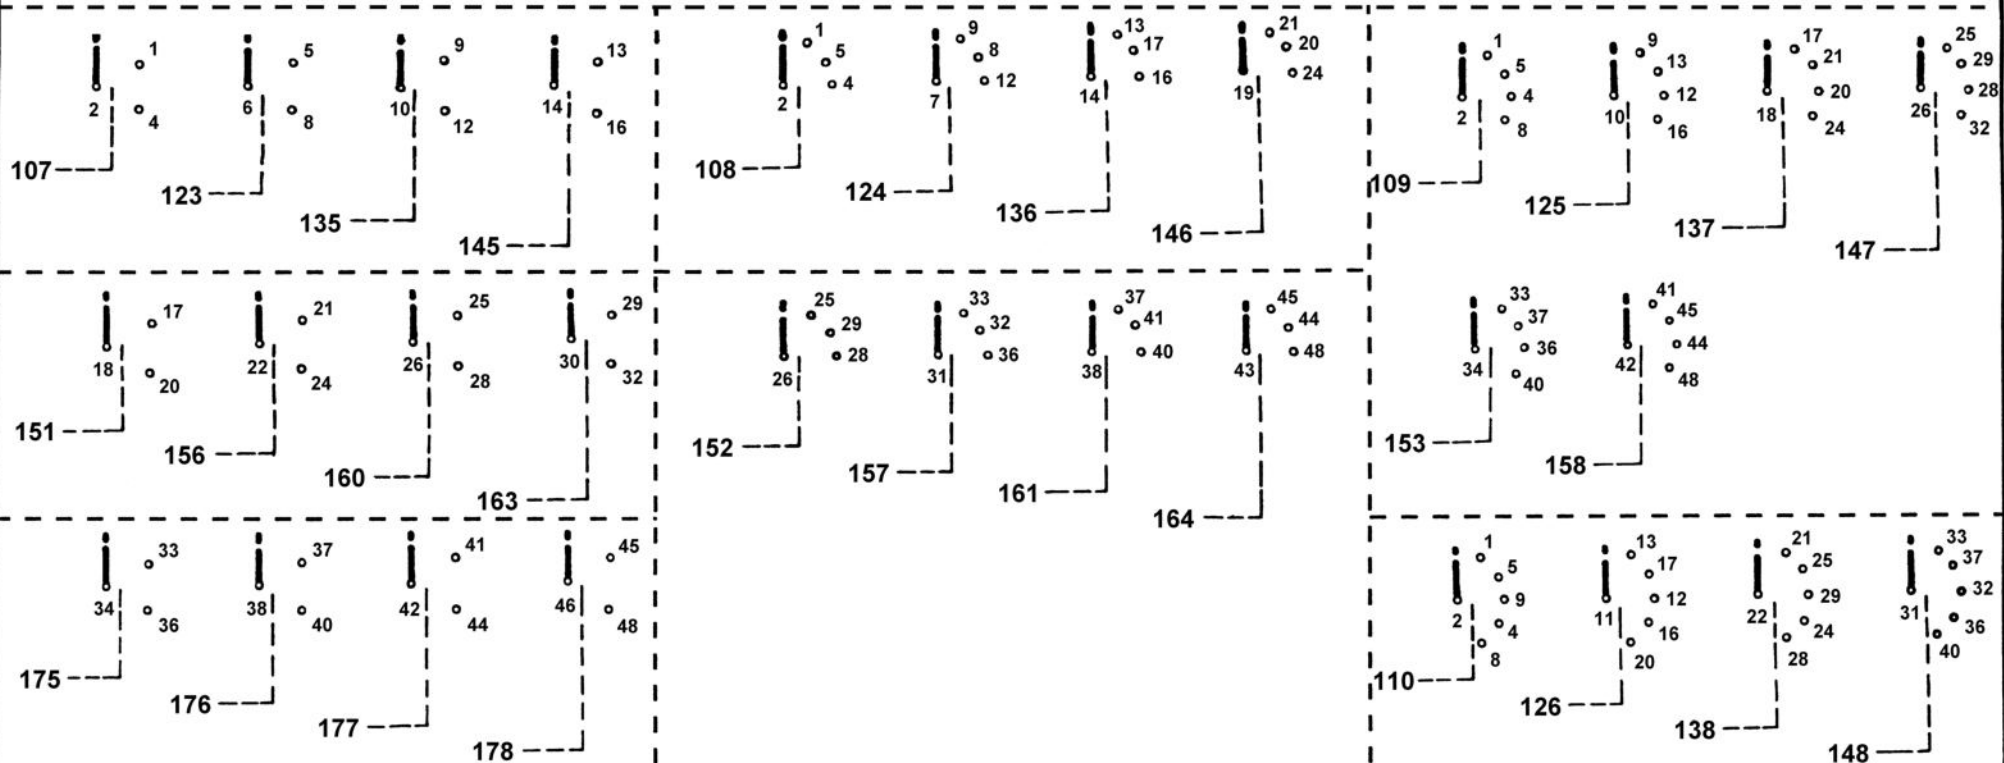

STEPENASTE SKLOPKE SA "0" POLOŽAJEM / MULTI-STEP SWITCHES WITH "0"

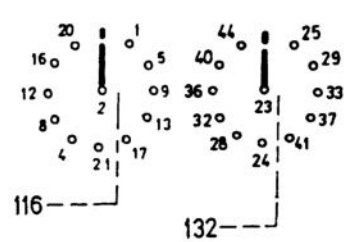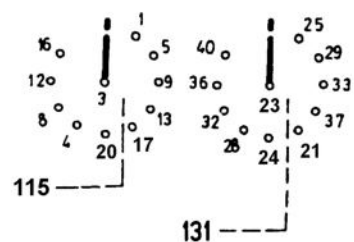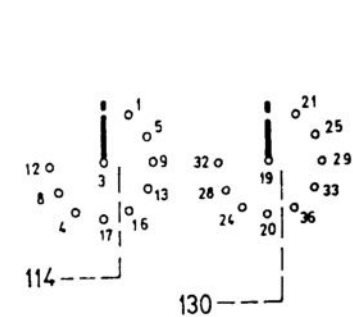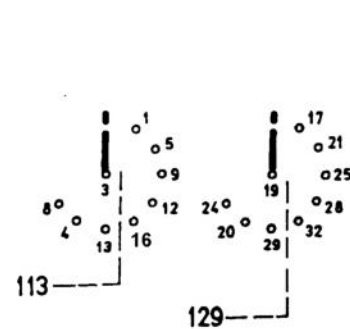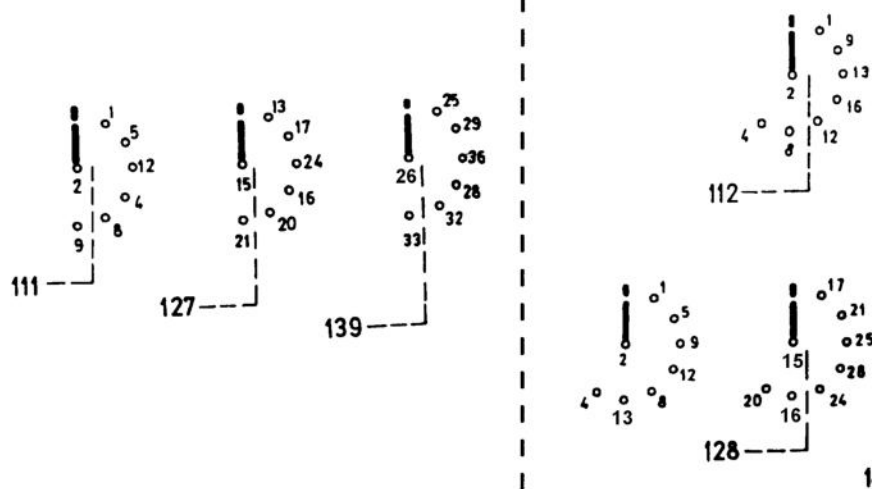

GRUPNE SKLOPKE / GANG SWITCHES

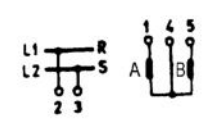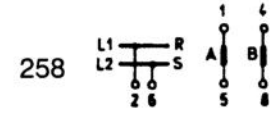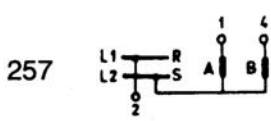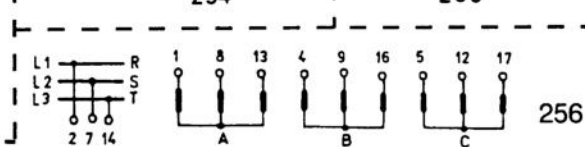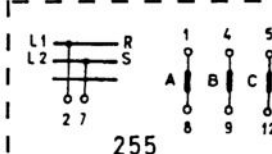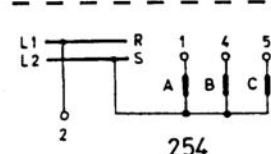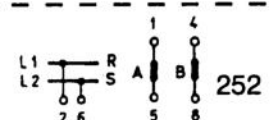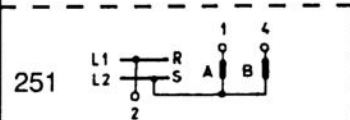

260